


MRT – ManuFlo Warranties void if opened by external service personnel / contractors.

We would like to point out that if warranty sticker seals are broken/removed and thus at some stage the top cover has been opened (possibly by service/calibration people) and when it was replaced the O-ring seal has not been seated in its slot resulting in it becoming crimped as the top cover section was pushed down and thus allowing a cavity for water to ingress resulting in destroying the PCB (see pic below and yellow circle). This is why we place the sealing stickers on the enclosure to discourage from opening. We strongly recommend calibrations be carried out by the use of the **NFC programming** software (available free on our website and utilised with an ANDROID phone with NFC capability -or purchase one from ManuFlo with preloaded software) negating the requirement to open the enclosure. But in the event that the cover is opened it is imperative that the O ring is pushed into the groove and secured before fastening the screws to close the unit up again.

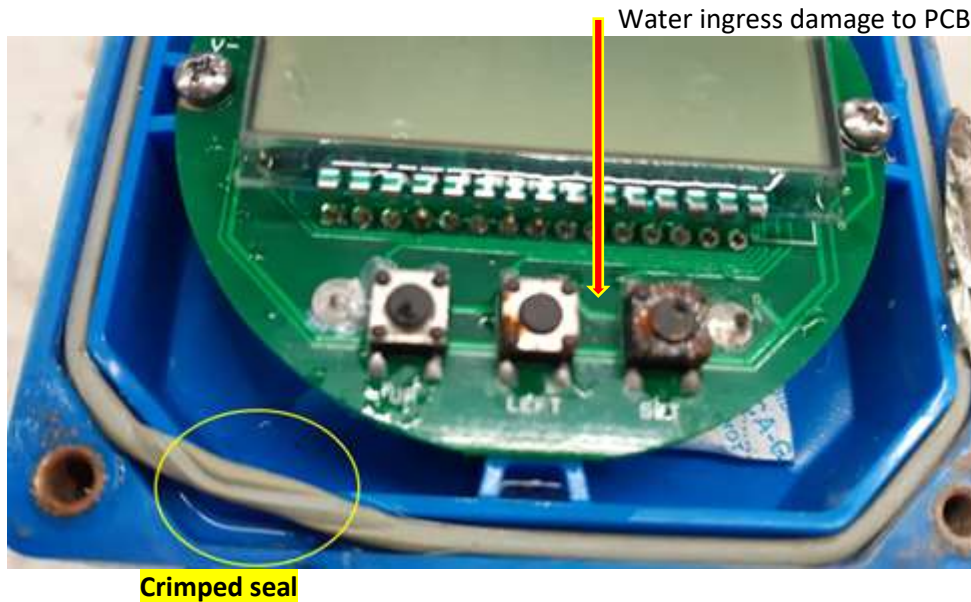

This being the case, return to ManuFlo for replacement of PCB and seal... or order spare parts from ManuFlo for do it yourself replacement.

ManuFlo®™

Flow Measurement & Control Products